REVIEWED		
By James Thum	at 3:57 pm,	Jul 14, 2021



IDAHO OIL AND GAS CONSERVATION COMMISSION

SUNDRY NOTICE



ME OF OPERATOR: Snake River Oil and Gas		Date	: <u>7-5-202</u>	21		
Address: 117 E. Calhoun St. (box 5	00)				8	
_{City:} Magnolia	_{State:} AR	Zip Code: 7	1753	_Telephon	le: 870.234.3	3080
Contact Name: Nate Caldwell		Ema	ail Address:	caldwell.r	nathan@weise	r-brown.com
Well Permit Number: 11-075-20033	Lease ar	nd Well Name (if different):	Barlow	1-14	
USWN / API Number: 11-075-20-033		Type of Well:	Oil Well X	Ga	as Well X	Other NGL
Field and Reservoir (if wildcat, so state):	Harmon				County:	Payette
Well Surface Location: Section: 14	Town	ship: <mark>8N</mark>	Rang	_{le:} 5W	(or b	lock and survey)
(give footage from Section lines):	1598' FSL	and 2458" F	NL			
Latitude/Longitude (Dec Degrees): ^{N44Deg C}	1'47.4581"	54'14.7547"	_ Datum: \	NGS84 _	NAD83	NAD27_X
Type of Submission: Notice of Intent X	_ Subsequer	nt Report	Final Abano	donment N	otice	
Type of Action: Acidize Alter Cas	ing Cas	ing Repair	_ Change	Plans	_ Convert to	Injection
Deepen New Construction	_ Hydraulic	Fracturing	Plug and A	bandon	Plug Bac	k
Production (Start/Resume) Rec Temporarily Abandon Water D						her X

Describe the proposed or completed operation, clearly stating all pertinent details including estimated starting date of the proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach a copy of the Bond under which the work will be performed or provide the Bond No. on file with IDL. Required subsequent reports shall be filed within thirty (30) days following completion of the involved operations. Final Abandonment Notices shall be filed only after operations, and only after all requirements, including reclamation have been completed and the operator has determined that the site is ready for final inspection.

<u>EROL- WILL RUM DOWN HOLE PRESSURE LANGES ADROSS</u> <u>EXISTIME PERFORMTIONS AND SHUT IN FOR 48 HRS. IM</u> <u>ETFORT TO COLLECT RESEVOER DATA</u> .
THEM GO IM HOLE AND PERFORATE INTERVALS 3467 - 3480 AMD
3449-3460'

Attach additional information as needed to support the application

RE-PERFORATING PROCEDURE SNAKE RIVER OIL AND GAS Barlow 1-14 Payette County, Idaho 11-075-20033 07/03/2021

- 1. Hold Safety meeting.
- 2. Move in and rig up slickline unit.
- 3. Make 2.25" gage ring run and tag bottom.
- 4. Run pressure/temperature gauges to mid-perforation of current perforations at 3509'.
- 5. Shut well in for 48 hours. Record 12-, 24-, 36-, and 48-hour surface pressure for correlation.
- 6. Pull out of the hole while making 5-minute stops at 3000', 2000', and 1000'.
- 7. Rig down and release slickline unit.
- 8. Move in and rig up wireline perforating unit and local crane.
- 9. Make 2.25" Gamma Ray/Casing Collar Locator run to PBTD.
- 10. Pull out of the hole and pick up perforating gun.
- 11. Go back in the hole with perforating gun and perforate the interval 3467' to 3480' with 6 SPF.
- 12. Pull out of the hole and pick up second perforating gun.
- 13. Go back in the hole with perforating gun and perforate the interval 3449' to 3460' with 6 SPF.
- 14. Pull out of the hole, rig down, and release wireline.
- 15. Flow test well.
- 16. Monitor fluid recovery and composition.



