

RECEIVED By James Thum at 8:49 am, Mar 07, 2022

IDAHO OIL & GAS

IDAHO OIL AND GAS CONSERVATION COMMISSION SUNDRY NOTICE

NAME OF OPERATOR:			Date:		
Address:					
City:	State:	Zip Code:	Te	elephone:	
Contact Name:		En	nail Address:		
Well Permit Number:	Lease	and Well Name	(if different):		
USWN / API Number:		Type of Wel	I: Oil Well	Gas Well	Other
Field and Reservoir (if wildcat, so state):			Cou	nty:
Well Surface Location: Section:(give footage from Section lines					
Latitude/Longitude (Dec Degrees): Type of Submission: Notice of Intent _ Type of Action: Acidize Alter C Deepen New Construction _ Production (Start/Resume) R Temporarily Abandon Water	Subseque Casing Casing Casing Casing Casing	uent Report Casing Repair lic Fracturing Recompleti	Datum: WG _ Final Abandon Change Pla _Plug and Abai on Stimu	S84 NAD83 ment Notice ans Conver adon Plug Batterian Test	3 NAD27 t to Injection Back
proposed work and approximate duration subsurface locations and measured and under which the work will be performed within thirty (30) days following complet operations, and only after all requirement the site is ready for final inspection.	d true vertical for provide the tion of the inve ents, including	depths of all per e Bond No. on fil olved operations reclamation hav	tinent markers a e with IDL. Red Final Abandor e been complet	and zones. Attach quired subsequent nment Notices sha ed and the operate	a copy of the Bond reports shall be filed II be filed only after or has determined that

Attach additional information as needed to support the application



IDAHO OIL AND GAS CONSERVATION COMMISSION SUNDRY NOTICE



	signed, state that I am the		ompany)		that	_ 	am
	to make this application and that this a		er my supe	ervisior	n and o	direc	ction
and that the facts stated here	in are true, correct and complete to the	best of my knowledge.					
Signature: Thomas	W. Dolence Gr.	Date:					
						_	
	This Sundry Notice sha	all be filed with the					
	Idaho Departme	nt of Lands					
	Division of Minerals, Pub						
	300 N. 6 th Street						
	Boise, Idaho	83702					
	as per IDAPA 20.07.02 and	d Idaho Code § 47-3.					
(ADDDOVED						
	APPROVED						
FOR IDL USE ONLY:	By James Thum at 8:50 am, Mar 07, 2						



IDAHO OIL AND GAS CONSERVATION COMMISSION SUNDRY NOTICE



Guidelines and Timeframes for Sundry Notices

<u>Activity</u>	<u>Timeframe</u>	Rule or Statute
Notices – General	Written notice must be given to the Department for any intention to do work and must be approved before work is done.	IDAPA 20.07.02.030
Hydraulic Fracturing	Operator will notify the Department twelve (12) to twenty-four (24) hours in advance of the treatment.	IDAPA 20.07.02.211.03
Accidents and Fires	Operator will notify the Department within twenty-four (24) hours and submit a full report within fifteen (15) days.	IDAPA 20.07.02.211.03
Well Spud & Surface Casing	Operator will notify the Department in writing not less than seventy-two (72) hours in advance of planned spud activity for surface casing.	IDAPA 20.07.02.310.05(a)
Cementing Surface Casing	Operator will notify the Department in writing not less than twenty-for (24) hours in advance of planned cementing activity for surface casing.	IDAPA 20.07.02.310.05(e)
Cementing Intermediate Casing	Operator will notify the Department in writing not less than twenty-for (24) hours in advance of planned cementing activity for intermediate casing.	IDAPA 20.07.02.310.07(d)
Cementing Production Casing	Operator will notify the Department in writing not less than twenty-for (24) hours in advance of planned cementing activity for production casing.	IDAPA 20.07.02.310.08(b)
Mechanical Integrity Testing	Operator will notify the Department in writing not less than ten (10) days in advance of the scheduled date on which the test will be performed.	IDAPA 20.07.02.320.03

Snake River Oil & Gas Dutch Lane 1-13

Flow test 3 intervals & complete as Casing / Annulus Dual (Revision 2)

Payette, County, Idaho

- 1 MI & RU WO unit.
- 2 ND DHT. NU frac valve and 7-1/16" BOP and test 250 / 3,000 psi.
- 3 PU 4-3/4" bit and 5-1/2" 15.5# casing scraper and TIH while PU tbg.
- 4 Clean pits & and take on completion fluid.
- 5 Displace well fluid w/ 9.6 ppg KCL (treated with biocide) C&C. POOH.
- 6 Run 4.75" GR/junk basket. POOH.
- 7 RIH w/ segmented bond log and log well (w/ 1,500 psi on casing if needed). POOH.
- 8 Test casing to 3,000 psi for 20 minutes and record on chart.
- 9 RIH w/ AS1-X pkr and tail pipe assembly and set @ ~ 3,824' (space out to accommodate BJ's for future dual).
- 10 TIH with production tbg. Tag packer.
- 11 Space out and set packer with 5K down.
- 12 Set BPV. ND frac valve and BOP's.
- 13 NU Tree. Pull BPV. Set 2 way check and test tree to 3,000 psi. Pull 2 way check.
- 14 RU WL. RIH with 2-1/8" expendable strip perforating guns.
- 15 Perforate the "3,850' Lower" from 3,946' 3,956' (10')
- 16 Zone tested wet- Decided to abandone.
- 17 Bullhead and kill well. Set BPV, ND tree, NU BOPE, pull BPV, set 2 way check, test 250 / 3,000 psi, pull 2 way check.
- 18 Install landing joint, unseat packer, POOH with tubing and packer.
- 19 RU WL. RIH & set 5-1/2" CIBP @ 3,940'. Test casing to 3,000 psi. POOH.
- 20 RIH w/ AS1-X pkr and tail pipe assembly and set @ ~ 3,824' (space out to accommodate BJ's for future dual).
- **21** TIH with production tbg. Tag packer.
- 22 Space out and set packer with 5K down.
- 23 Set BPV. ND frac valve and BOP's.
- 24 NU Tree. Pull BPV. Set 2 way check and test tree to 3,000 psi. Pull 2 way check.
- 25 RU WL. RIH with 2-1/8" strip perforating guns.
- 26 Perforate the "3,850' Upper" from 3,864' 3,902' (38')
- 27 Zone made condensate, water & sand Decided to abandone.
- 28 Bullhead and kill well. Set BPV, ND tree, NU BOPE, pull BPV, set 2 way check,test 250 / 3,000 psi, pull 2 way check.
- 29 Install landing joint, unseat packer, POOH with tubing and packer.
- **30** RU WL. RIH & set 5-1/2" CIBP @ 3,850'. Test casing to 3,000 psi.
- 31 Dump bail cmt from 3,800' to 3,850'. Test plug to 3,000 psi for 20 minutes and record on chart.
- 32 RIH w/ AS1-X pkr and tail pipe assembly on p[ipe and set @ ~ 3,649' (space out to accommodate BJ's for future dual).
- 33 PU tbg hanger. Set pkr and set 5K down. Test backside.
- 34 Set BPV. ND frac valve and BOP's.
- 35 NU Tree. Pull BPV. Set 2 way check and test tree to 3,000 psi. Pull 2 way check.
- 36 RU WL. RIH with 2" RTG (hollow carrier) perforating guns.
- 37 Perforate the "D Sand" from 3,712' 3,756' (44') Swab & flow test as needed.
- 38 RU WL. RIH with 2-7/8" CIBP & set same @ 3,665'. Test to 1,000 psi. POOH & RD WL.
- 39 Set BPV, ND tree, NU BOPE, pull BPV, set 2 way check, test 250 / 3,000 psi, pull 2 way check.
- 40 Install landing joint, "J" off on/off tool. POOH with tubing.
- 41 RU WL. RIH with 2" RTG (hollow carrier) perforating guns.
- 42 Perforate the "C Sand" from 3,428' 3,444' (16')
- **43** TIH with blast joints, sliding sleeve and production tbg. Tag packer.
- 44 Space out and set packer with 5K down.
- 45 Set BPV. ND frac valve and BOP's.
- 46 NU Tree. Pull BPV. Set 2 way check and test tree to 3,000 psi. Pull 2 way check.
- 47 RU SL. RIH with B shifting tool and open SS.
- 48 Swab as needed to unload load water on casing side. Flow load water to rig tank.

- 49 RU SL. RIH with B shifting tool and close SS.
 50 RU WL. RIH and jet cut tbg above CIBP in the packer tail pipe assembly.
 51 Swab as needed to unload water on tbg side. Flow load water to rig tank.
- **52** Turn well over to production.

